



AK-SC255 R: Software Update VR02_171

Product Note

Information	Action required	Market
<input checked="" type="checkbox"/> Technical	<input type="checkbox"/> FYI only	<input checked="" type="checkbox"/> Food Retail
<input type="checkbox"/> Commercial	<input checked="" type="checkbox"/> Inform customers (Where required)	<input type="checkbox"/> Commercial Refrigeration OEMs (CRO)
<input type="checkbox"/> _____	<input checked="" type="checkbox"/> Upgrade instruction attached	<input type="checkbox"/> Commercial Air Conditioning OEMs (CAO)

Summary New Software is now available VR02_171
 VR02_171 replaces VR02_155 and offers updates and fixes (see below table)

Description New 255 Software update

Affected products AK-SC255 R version
 All versions

Timing Immediate

Updates / Corrections The table below highlights new features and updates

Defect ID	Synopsis
961664	Ethernet alarm dialout run into problems with "port in use" messages in the Transmission Log; rest unit then alarms dialout
961802	Add R407F to refrigerant options
961993	Circuit Type information does not display in EDS Protocol
962006	RS232 Connection with AKA65 - issue when set to Ethernet Host and no IP address
962009	"Current Value:" for an I/O Comm error cleared alarm sends incorrect value of "Online" should be "Cleared"
962011	Add Delay times to misc relays
962017	Need to have default names added alarm phone # 1-3 and network connections # 1-4 instead of a blank name field.
962025	New EDF's - to be checked in for upcoming release.
962033	Setting up reheat dehumid type, number of stages navigation error.
962034	Speed up Mai Extraction
962038	XML Tags for Daylight Savings not correct
962039	XML Writes for Lighting times do not detect same value correctly if trying to write same value
962044	Relative lighting schedule issue when crossing midnight.
962046	Decimal added to lighting configuration when footcandle lighting is selected
962050	Alarms Sent from Controller in XML format are not logged in Transmit log
962059	Reset type 576 upon clock change by user
962071	Phase List Identification for paramters in XML interface can change per software build
962073	No damper settings screen navigation
962083	issuing read_branch command on SYS.RKS tag with large database causes unit to reset
962110	Host network issue with mixed software versions
962112	EDF Updates - XML Additions - need completed EDF files checked into PVCS

962113	cooling night setback restricting damper control
962129	AK-CC750 - New US version 5.9x - AK-SC255 update required for change of CID/VID #s affecting quick set-ups
962143	Random values appearing in either the 255/55 for HGM leak.
962144	Need the group of Type 1 EDF files and the device.lst file checked in for the 255 Version 2.170 development

Upgrade instructions



AK-SC255_Upgrade Procedure.pdf



EDF List_171 RESM.pdf

Contact

Technical Support:

Stan Blitstein

stanblitstein@danfoss.com

Danfoss Baltimore, USA

SAP / Pricing Support:

Ingrid Schmolk

E-mail ingridschmolk@danfoss.com

Danfoss Baltimore, USA

Global Product Manager:

Andrew I Niblock

E-mail: niblock@danfoss.com

Danfoss Baltimore, USA

Product Manager:

Rainer Mahringer

E-mail: rainer.maehringer@danfoss.com

Danfoss Baltimore, USA